



REPORT TO THE CITY OF PEORIA COMMUNITY SERVICES DEPARTMENT

Section 31: Pioneer Community Park

November 20, 2013

Legend of Abbreviations

aff...	Above the finished ground
AR...	Accessible Route
CIL...	Change in Level
CFS...	Clear Floor Space
EPC...	Elevated Play Component
GLPC...	Ground Level Play Component

Background

RAC visited Pioneer Community Park to conduct an access audit. The findings are below.

- 1.1 Parking – Athletic and Ball Fields** [[CHECKLIST](#)] slopes- 2.6% aisle 3 [PC45](#), [PC46](#), 2.5% stall 3 [PC47](#), [PC48](#), 2.3% stall 4 [PC49](#), [PC50](#), 2.3% aisle 4 [PC51](#), [PC52](#); lacks van sign (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.1.1 and 1.1.2 is integral to compliance with title II program access test): (Athletic and Ball Fields)

- 1.1.1 ***Repair or correct slope*** of parking space and access aisle to max 2.08% in any direction (PC45, PC46, PC47, PC48, PC49, PC50, PC51, PC52)
 1.1.2 ***Add one van parking sign*** to one accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8' (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Athletic Fields [[CHECKLIST](#)] slopes- 2.5% stall 2 [PC40](#), [PC41](#), 2.9% aisle 1 [PC42](#), [PC43](#); lacks van sign (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.1.1 and 1.1.2 is integral to compliance with title II program access test): (Athletic Fields)

- 1.1.1 ***Repair or correct slope*** of parking space and access aisle to max 2.08% in any direction (PC40, PC41, PC42, PC43)
 1.1.2 ***Add one van parking sign*** to one accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8' (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Dog Park [[CHECKLIST](#)] last aisle 57.5" wide [PC54](#), [PC55](#); lacks van sign (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.1.1 and 1.1.2 is integral to compliance with title II program access test): (Dog Park)

- 1.1.1 **Repaint** stalls and access aisles to be 8' and 5' each (PC54, PC55)
- 1.1.2 **Add one van parking sign** to one accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8' (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Splash Pad [\[CHECKLIST\]](#) - no issues

- 1.2 Exterior Accessible Route - [\[CHECKLIST\]](#)** detectable warning placement at parallel curb ramp near softball fields fails [PC52](#); gaps- 1" along expansion joints in ball field area [PC58](#), [PC59](#), [PC63](#), tree grates have large openings [PC60](#); 5.6% running slope along field 1 and 2 fence [PC61](#), [PC62](#); passenger loading zone lacks access aisle, connects to AR through vehicular way [PC64](#), [PC65](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.2.1 through 1.2.5 is integral to compliance with title II program access test):

- 1.2.1 **Reinstall** detectable warning at parallel ramps to run perpendicular along edge of AR where it connects to vehicular way (PC52)
- 1.2.2 **Correct or fill** gaps along AR (PC58, PC59, PC63)
- 1.2.3 **Replace** tree grates with ones having opening of max .5", or provide a barrier to prevent pedestrian access (PC60)
- 1.2.4 **Correct or repair** sidewalk running slope along AR to max 5% (PC61, PC62)
- 1.2.5 **Designate** an access aisle for passenger drop off area by painting an aisle that is 60" wide and 20' long and provide direct access to a curb ramp (PC64, PC65)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

- 1.3 Playground Designated Entry - [\[CHECKLIST-2 TO 5\]](#) [\[CHECKLIST-5 TO 12\]](#)**

2 to 5: lacks posted age signage (checklist)

5 to 12: no issues

Recommendations (Pioneer Community Park is designated as accessible so 1.3.1 is integral to compliance with title II program access test):

- 1.3.1 **Acquire and install** intended user signage and mount at designated entry as a smart practice at 2 to 5 structure (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.4 **Playground Surface/Accessible Route within -** [[CHECKLIST-2 TO 5](#)] [[CHECKLIST-5 TO 12](#)]

2 to 5: 3.6% cross slope near bucket swings [PC124](#), [PC125](#); lacks 80" vertical clearance at crawl panel [PC108](#)

5 to 12: 5.3% cross slope near blue spinner [PC126](#), [PC127](#); lacks 80" vertical clearance (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.4.1 and 1.4.2 is integral to compliance with title II program access test):

1.4.1 **Repair or correct cross slope** of play area accessible surface to max 2.08% in both (PC124, PC125, PC126, PC127)

1.4.2 For vertical clearance issues, **see GLPC's below** (PC108, checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.5 **Transfer System -** [[CHECKLIST-2 TO 5](#)] [[CHECKLIST-5 TO 12](#)]

2 to 5: lacks second transfer (checklist)

5 to 12: no issues

Recommendations (Pioneer Community Park is designated as accessible so 1.5.1 is integral to compliance with title II program access test):

1.5.1 **Consider** adding second transfer system on 2 to 5 structure as a smart practice (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.6 **Ramps - not applicable**

1.7 Elevated Play Components - [[CHECKLIST-2 TO 5](#)] [[CHECKLIST-5 TO 12](#)]

2 to 5: 13 of 13 EPCs compliant, apply incentive scoping due to lack of ramp (checklist)

5 to 12: 13 of 14 EPCs compliant, apply incentive scoping due to lack of ramp (checklist)

1.8 Ground Level Play Components - [[CHECKLIST-2 TO 5](#)] [[CHECKLIST-5 TO 12](#)]

2 to 5: lacks accessible swing and climber types (checklist); meets incentive scoping (checklist)

5 to 12: meets incentive scoping (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.8.1 and 1.8.2 is integral to compliance with title II program access test):

1.8.1 ***Lower entry point for one bucket swing*** to 11” to 24” aff at 2 to 5 structure (checklist)

1.8.2 ***Add*** an accessible climber to meet one of each type accessible at 2 to 5 structure (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.9 Sand box/Play tables - not applicable

1.10 Park Site - [[CHECKLIST](#)]

Note: in our opinion the crushed stone surface at this site was too loose to be an accessible surface. At other Department sites this surface was more compact and in our opinion accessible. The use of this surface requires frequent inspection and regular maintenance if it is to serve as an accessible surface.

Ball Fields (6): hardware high on all gates [PC128](#), [PC129](#), [PC133](#), [PC134](#)

Athletic Fields (4): lacks AR to both sides of fields [PC152](#), [PC153](#), [PC154](#)

Drinking Fountains (5): lacks knee clearance at fields 1,5,6 [PC138](#), [PC139](#); all lack correct spout angle

Vending Machines (4): all lack reach range due to placement back from locked cage [PC141](#), [PC157](#), [PC174](#)

Dog Parks (3): grass and loose gravel surfaces, lack AR to amenities provided [PC161](#), [PC162](#), [PC163](#), [PC164](#), [PC165](#), [PC166](#), [PC168](#), [PC169](#), [PC170](#); lacks CFS at large park fountain [PC167](#)

Heritage Court: stage lacks AR due to loose surface [PC179](#), [PC180](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.10.1 through 1.10.8 is integral to compliance with title II program access test):

- 1.10.1 **Lower** gate hardware at ball field entry gates to max 48" agl (PC128, PC129, PC133, PC134)
- 1.10.2 **Create AR** with crushed and compacted stone or similar outdoor material from parking or sidewalk to both sides of the athletic fields (PC152, PC153, PC154)
- 1.10.3 **Raise** drinking fountains at fields 1, 5 and 6 to provide 27" knee clearance (PC138, PC139)
- 1.10.4 **Adjust** angle of the fountain spouts to be 30 degrees measured from the front of the unit (checklist)
- 1.10.5 **Reposition** vending machines to be within reach range of the cage opening, or provide alternate means of vending (PC141, PC157, PC174)
- 1.10.6 **Extend** AR to one of each type of amenity in each dog park (PC161, PC162, PC163, PC164, PC165, PC166, PC168, PC169, PC170)
- 1.10.7 **Provide** 30" by 48" CFS at large dog park drinking fountain (PC167)
- 1.10.8 **Replace** existing loose surface with firm, stable and slip resistant surface for access to stage in Heritage Court (PC179, PC180)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.11 Shelters/Picnic Areas - [\[CHECKLIST\]](#)

Ramadas 1, 3, 5: outlet under sink counter (checklist)

Ramadas 2, 4, 6: outlet under sink counter [PC186](#), [PC187](#)

Ramada 7: grill off AR due to surface (checklist); grill high [PC194](#), [PC195](#)

Ramada 8: grill off AR due to surface (checklist)

Ramada 9: 2 of 2 tables lack knee clearance [PC190](#); lacks AR to grill due to surface [PC191](#)

Ramada 10, 11: lacks AR to grill due to surface [PC191](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.11.1 and 1.11.2 is integral to compliance with title II program access test):

- 1.11.1 **Relocate or add** a second outlet in Ramadas 1,2, 3, 4, 5 and 6 that is within reach range (PC186, PC187, checklist)
- 1.11.2 **Leave as is**, grills and tables in Ramadas 7-9 and designate ramadas 1-6 as accessible (PC194, PC195, PC191, PC190, checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

1.12 Park Buildings -

Doors: [\[CHECKLIST\]](#)

Maneuvering Clearance: splash pad storage- storage [PC66](#); splash pad plumbing chase- push side pipe [PC67](#); electrical at ball fields- push side shelf [PC68](#); register side concession- push side ice machine, storage [PC69](#); concession to grill- push side garbage [PC70](#); electrical near 6- equipment [PC73](#); storage near 6- storage [PC74](#); electrical at athletic fields- equipment [PC75](#); athletic fire- push side storage [PC76](#)

Change in Level: sink side concession- .5" [PC71](#), [PC72](#)

LBF: 13 of 14 exterior doors exceed 8.5 lbf to open (checklist)

Closer: 7 of 14 exterior doors close too fast (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.12.1 through 1.12.6 is integral to compliance with title II program access test): (Doors)

- 1.12.1 For doors along public circulation route, **relocate storage and other obstacles** for 60" maneuvering space at doors (PC66, PC68, PC69, PC70, PC74, PC76)
- 1.12.2 **Leave as is**, employee areas with equipment (PC73, PC75)
- 1.12.3 For all doors along the public circulation route, **repair, bevel, or ramp CIL** at sink side concession door entries to max .25" (PC71, PC72)
- 1.12.4 For all doors along the public circulation route, **inspect, adjust, and maintain** 8.5 lbf to open exterior doors as a smart practice (checklist)
- 1.12.5 For all doors along the public circulation route, **inspect, adjust, and maintain** closing speed on door closers so that doors do not close to 3" faster than 3 seconds when started at 70 degrees (checklist)
- 1.12.6 **Upon renovation;** make above corrections to employee only doors

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Rooms: [\[CHECKLIST\]](#)

Public:

Clear Floor Space: break room- AED [PC83](#)

Reach Range: break room- 58" coat hooks [PC84](#), [PC85](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.12.1 and 1.12.2 is integral to compliance with title II program access test): (Rooms - Public)

- 1.12.1 ***Remove, or relocate storage*** in CFS at fixtures and operable parts (PC83)
- 1.12.2 ***Lower operating mechanisms*** in break room to max 48" aff to highest operable part (PC84, PC85)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Employee:

36" Access Aisle: storage at splash pad- storage [PC77](#); plumbing at splash pad- narrows at pipes [PC79](#); storage near 6- storage [PC88](#); storage at athletic fields- storage [PC90](#); fire at athletic fields- storage [PC91](#)

60" Turning Space: storage at splash pad- storage (checklist); fire at athletic fields- storage [PC91](#)

Protruding Objects: plumbing at splash pad- AED 10" [PC80](#), [PC81](#); fire at athletic fields- AED [PC91](#)

Floor Surfaces: plumbing at splash pad- gap at drain [PC82](#); fire at athletic fields- gap at drain [PC93](#)

Clear Floor Space: storage at splash pad- storage at panels [PC78](#); electrical at athletic fields- panels [PC89](#); fire at athletic fields- AED [PC91](#), light switch [PC92](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.12.1 through 1.12.3 is integral to compliance with title II program access test): (Rooms - Employee)

- 1.12.1 Employee only area permit approach, entry, exit, **relocate obstacles** such as tables for AR through noted rooms (PC77, PC79, PC88, PC90, PC91)
- 1.12.2 Employee only areas permit approach, entry, exit, **relocate obstacles** for 60" turning space in splash pad storage, fire at athletic fields (PC91, checklist)
- 1.12.3 For all other deficits, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (PC78, PC80, PC81, PC82, PC89, PC91, PC92, PC93)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Restrooms: [\[CHECKLIST\]](#)

Play Area:

Both: seat height- 20.5" M [PC199](#), [PC200](#), 19.25" W [PC205](#), [PC206](#); grab bars- toilet paper located 7" above side bar [PC201](#), [PC202](#), [PC207](#), [PC208](#); flush centered [PC203](#); hand dryers protrude 7.25" [PC204](#)

Men's: faucet does not stay on 10 seconds (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.12.1 through 1.12.5 is integral to compliance with title II program access test): (Restrooms - Play Area)

- 1.12.1 **Replace toilet seat, or re-set or replace toilet** to 17" to 19" aff in both (PC199, PC200, PC205, PC206)
- 1.12.2 **Remount** TP dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar in both (PC201, PC202, PC207, PC208)
- 1.12.3 **Leave as is**, centered flush, acceptable alternative (PC203)
- 1.12.4 **Relocate or recess** hand dryers to not interfere with general circulation path, protrusions can't be greater than 4" in both (PC204)
- 1.12.5 **Adjust timing** of sink faucets to remain on min 10 seconds in M (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Ball Fields:

Both: seat height 19.25" W [PC211](#), [PC212](#), 19.5" M [PC220](#), [PC221](#); grab bars TP mounted 7" above [PC213](#), [PC214](#), [PC223](#), [PC224](#); flush control centered in W [PC215](#), slightly to closed side M [PC222](#); hand dryers protrude 7.25" [PC216](#), [PC217](#), [PC225](#)

Men's: urinal 17.25" aff [PC218](#), [PC219](#); rear grab bar mounting fails [PC222](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.12.1 through 1.12.6 is integral to compliance with title II program access test): (Restrooms - Ball Fields)

- 1.12.1 **Replace toilet seat, or re-set or replace toilet** to 17" to 19" aff in both (PC211, PC212, PC220, PC221)
- 1.12.2 **Remount toilet paper dispenser** max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar in both (PC213, PC214, PC223, PC224)
- 1.12.3 **Leave as is**, centered flush, acceptable alternative (PC215, PC222)
- 1.12.4 **Relocate or recess** hand dryers to not interfere with general circulation path, protrusions can't be greater than 4" in both (PC216, PC217, PC225)
- 1.12.5 **Leave as is**, urinal height; cite construction tolerance (PC218, PC219)
- 1.12.6 **Remount rear grab bar** to behind the toilet, 12" to one side of center and 24" to the other and 33" to 36" aff in men's (PC222)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Multi-Use Fields:

Both: signs mounted 60.5" to bottom of tactile letters [PC226](#), [PC227](#), [PC232](#); grab bars- toilet paper mounted above, 7" in men's [PC228](#), [PC229](#), 6.5" in women's [PC234](#), [PC235](#); hand dryers protrude 7" [PC230](#), [PC231](#), [PC233](#)

Women's: stall door location fails- 4.25" [PC236](#), [PC237](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.12.1 through 1.12.4 is integral to compliance with title II program access test): (Restrooms - Multi-Use Fields)

- 1.12.1 **Remount** signage on wall, latch side of the door, 48" to baseline of lowest character, 60" to baseline of highest character in both (PC226, PC227, PC232)
- 1.12.2 **Remount TP dispenser** max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar in both (PC228, PC229, PC234, PC235)
- 1.12.3 **Relocate or recess** hand dryers to not interfere with general circulation path, protrusions can't be greater than 4" in both (PC230, PC231, PC233)

1.12.4 **Leave as is**, door mounting in W; cite construction tolerance (PC236, PC237)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.13 **Other - Concessions** [[CHECKLIST](#)] menu lacks pictures [PC95](#); sinks high- 36" hand wash [PC96](#), [PC97](#), 36.5" hand wash [PC98](#), [PC99](#), 34.75" hand wash [PC100](#), [PC101](#), 37.5" triple basin [PC102](#), [PC103](#); pipes lack insulation (checklist); all lacks knee clearance [PC104](#), [PC105](#), (checklist); paper towels lack CFS [PC106](#); all outlets high over 36" counter [PC97](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.13.1 and 1.13.2 is integral to compliance with title II program access test): (Concessions)

1.13.1 **Replace** menu with one having pictures and lettering of compliant size based on viewing distance as a smart practice (PC95)

1.13.2 For all other deficits, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (PC96, PC97, PC98, PC99, PC100, PC101, PC102, PC103, PC104, PC105, PC106, PC97, checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

Trail [[CHECKLIST](#)] lacks trail signage (checklist)

Recommendations (Pioneer Community Park is a site designated as accessible so 1.13.1 is integral to compliance with title II program access test): (Trail)

1.13.1 **Mount** signage at all trail heads indicating length of accessible trail segment, surface type, typical and min. tread width, typical and max running slope, typical and max. cross slope as a smart practice (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

Fishing [[CHECKLIST](#)] no issues

MAINTENANCE

1.1 **Parking** - not applicable

1.2 **Exterior Accessible Route (includes common area and stairs)-** [\[CHECKLIST\]](#) lacks AR, gravel or crushed stone surfaces from parking [PC16](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.2.1 is integral to compliance with title II program access test):

1.2.1 **Extend AR** of a firm, stable and slip resistant material from ramada parking to maintenance entry (PC16)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.3 **Exterior Entry Signage** - [\[CHECKLIST\]](#) lacks symbol of access (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.3.1 is integral to compliance with title II program access test):

1.3.1 **Mount signage** at entrance designating it as accessible (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.4 **Exterior Entry Doors** - [\[CHECKLIST\]](#)

Maneuvering Clearance: bay- storage [PC19](#); mechanical- storage [PC20](#); complex entry- pull side bollard [PC21](#)

LBF: 3 of 3 exterior doors exceed 8.5 lbf to open (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.4.1 through 1.4.3 is integral to compliance with title II program access test):

1.4.1 For all doors along the public circulation route, **relocate storage, furniture, and other obstacles** to create 60" maneuvering space around doors (PC19, PC20, PC21)

1.4.2 For all doors along the public circulation route, **inspect, adjust, and maintain** 8.5 lbf to open exterior doors as a smart practice (checklist)

1.4.3 **Upon renovation;** make above corrections to employee only doors

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.5 Elevator or Lift - not applicable

1.6 Interior Doors - [\[CHECKLIST\]](#)

Maneuvering Clearance: computer- pull side shelf [PC17](#); break to hall- utility sink [PC18](#)

LB: 4 of 4 interior doors exceed 5 lbf to open (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.6.1 through 1.6.3 is integral to compliance with title II program access test):

- 1.6.1 For all doors along the public circulation route, **relocate storage, furniture, and other obstacles** to create 60" maneuvering space around doors (PC17, PC18)
- 1.6.2 For all doors along the public circulation route, **inspect, adjust, and maintain** 5 lbf to open interior doors (checklist)
- 1.6.3 For employee only doors; make above corrections **upon renovation**

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.7 Interior Accessible Route (includes common area and stairs) - [\[CHECKLIST\]](#)

exterior spout near drinking fountain 48" reach over bench [PC36](#), [PC37](#); hand sanitizers protrude 5" [PC29](#), [PC30](#); drinking fountain- spout angle fails [PC35](#), spout flow height fails (checklist), knee clearance 26.5" [PC33](#), [PC34](#); lacks egress signage (checklist); bench lacks CFS due to drinking fountain [PC38](#), [PC39](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.7.1 through 1.7.6 is integral to compliance with title II program access test):

- 1.7.1 **Remove** portion of exterior bench to provide CFS to reach spout (PC36, PC37)
- 1.7.2 **Relocate protruding objects** along the interior AR or place cane detectable warning at foot of hand sanitizer (PC35)
- 1.7.3 **Adjust** angle of the fountain spout to be 30 degrees measured from the front of the unit and adjust spout flow to max 4" (PC35)
- 1.7.4 **Raise** drinking fountain to provide 27" knee clearance (PC33, PC34)
- 1.7.5 **Acquire and mount** signage along the designated egress route (checklist)

1.7.6 *If 1.7.1 above* is done, there will be adequate CFS at the bench (PC38, PC39)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.8 Public Designated Use Spaces (includes classrooms, meeting rooms, special purpose rooms, and other spaces intended for use by the public) - [CHECKLIST]

Protruding Objects: break- MSDS [PC9](#), [PC10](#), AED [PC3](#), [PC5](#), time clock [PC4](#), [PC5](#)

Clear floor space: break- paper towels [PC8](#)

Reach Range: break- soap [PC8](#)

Sinks: break- 34.5" [PC6](#), [PC7](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.8.1 through 1.8.4 is integral to compliance with title II program access test):

- 1.8.1 **Relocate protruding objects** in break room or place cane detectable warning at foot of MSDS book, AED and time clock (PC9, PC10, PC3, PC5, PC4)
- 1.8.2 **Remove, or relocate storage** in CFS at fixtures and operable parts (PC8)
- 1.8.3 **Lower soap** in break room to max 48" aff to highest operable part (PC8)
- 1.8.4 **Leave as is**, sink in break room, cite construction tolerance (PC6, PC7)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.9 Employee Offices and Spaces - [CHECKLIST] 36" access aisle: mechanical-reduces to side [PC15](#)

Clear floor space: computer- key box [PC1](#); bay- fire pull [PC14](#), panels [PC12](#)

Reach Range: computer- key box [PC1](#); bay- first aid, eye wash [PC11](#), emergency shower handle [PC13](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.9.1 and 1.9.2 is integral to compliance with title II program access test):

- 1.9.1 Employee only area permit approach, entry, and exit, **relocate obstacles** such as tables and chairs to create AR through mechanical (PC15)

1.9.2 For all other deficits, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (PC1, PC11, PC12, PC13, PC14)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.10 **Assembly Areas** - not applicable

1.11 **Restrooms** - [\[CHECKLIST\]](#) centerline 18.5" [PC22](#), [PC23](#); toilet paper 7" above grab bar [PC24](#), [PC25](#); pipes lack insulation [PC26](#); paper towels protrude 9.5" [PC27](#), [PC28](#)

Recommendations (Pioneer Community Park is designated as accessible so 1.11.1 through 1.11.4 is integral to compliance with title II program access test):

1.11.1 **Remount** toilets to 16" to 18" from the side wall to centerline (PC22, PC23)

1.11.2 **Remount toilet paper dispenser** max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar (PC24, PC25)

1.11.3 **Insulate exposed pipes** under sink (PC26)

1.11.4 **Relocate or recess** towel dispenser to not interfere with general circulation path, protrusions can't be greater than 4" (PC27, PC28)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.12 **Kitchen/Concessions** - not applicable

1.13 **Locker Rooms** - not applicable

1.14 **Aural and Visual Alarms** - [\[CHECKLIST\]](#) no issues

1.15 **Directional and Permanent Space Signs** - [\[CHECKLIST\]](#) lacks signage at permanent rooms and spaces (checklist); lacks compliant exit signage (checklist)

Recommendations (Pioneer Community Park is designated as accessible so 1.15.1 through 1.15.3 is integral to compliance with title II program access test):

1.15.1 **Create template for signs** that addresses height of sign, size of characters, location of Braille, and other requirements

1.15.2 **Implement a sign revision program** throughout the building, discriminating between directional signs and signs for permanent spaces

1.15.3 **Mount signage** at all permanent rooms/spaces having Braille and the international symbol of accessibility, mounted at 60" to the middle of the sign and on the latch side of the door (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE ONE

1.16 **Other** - not applicable

PEORIA PIONRCOMPK SEC31