



# REPORT TO THE CITY OF PEORIA COMMUNITY SERVICES DEPARTMENT

## Section 10: Peoria Pool

July 16, 2013

### Legend of Abbreviations

**aff...** above the finished floor (or  
above the finished ground)  
**AR...** Accessible Route  
**CIL...** Change in Level  
**CFS...** Clear Floor Space  
**lbf...** Pounds of Force

**Background**

RAC staff conducted an access audit at the Peoria Pool. Our findings are below.

***This was a limited scope audit.*** We did not audit any areas that are owned and operated by the high school. We did audit the path of travel from the closest parking to the entry of the pool. We **encourage** the Department to share the findings with the school district.

**1.1 Parking** - Did not audit

**1.2 Exterior Accessible Route (includes common area and stairs)-**  
[\[CHECKLIST-EAR\]](#)

Exterior Route: no marked path where AR crosses vehicular way [PP1](#), [PP2](#); lacks detectable warnings [PP3](#); cross slopes- 3% by bollards [PP4](#), [PP5](#); 4.4% at gate [PP6](#), [PP7](#); 6.1% by electrical rm [PP8](#), [PP9](#); 5.7% running slope entering pool area [PP10](#), [PP11](#)

***Recommendations (Peoria Pool is a site designated as accessible so 1.2.1 through 1.2.4 is integral to compliance with title II program access test):***

- 1.2.1 **Create lined cross walk** where pedestrian pathway crosses through vehicular traffic as a smart practice (PP1, PP2)
- 1.2.2 **Install detectable warning** at curb ramps and transitions from walkways to vehicular ways as a smart practice (PP3)
- 1.2.3 **Correct or repair** sidewalk cross slope along AR to max 2.08% (PP4, PP5, PP6, PP7, PP8, PP9)
- 1.2.4 **Correct or repair** sidewalk running slope along AR to max 5% (PP10, PP11)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

**1.3 Exterior Entry Signage** - Did not audit

**1.4 Exterior Entry Doors** - Did not audit

**1.5 Elevator or Lift** - Did not audit

**1.6 Interior Doors** - Did not audit

**1.7 Interior Accessible Route (includes common area and stairs)** - Did not audit

**1.8 Public Designated Use Spaces (includes classrooms, meeting rooms, special purpose rooms, and other spaces intended for use by the public)** - Did not audit

- 1.9 **Employee Offices and Spaces** - Did not audit
- 1.10 **Assembly Areas** - Did not audit
- 1.11 **Restrooms** - Did not audit
- 1.12 **Kitchen/Concessions** - Did not audit
- 1.13 **Locker Rooms** - Did not audit
- 1.14 **Aural and Visual Alarms** - Did not audit
- 1.15 **Directional and Permanent Space Signs** - Did not audit
- 1.16 **Other - Pool** [[CHECKLIST](#)] CIL at hose and cover [PP21](#), [PP22](#); CIL at hose near lift [PP12](#); 1" gap [PP23](#), [PP24](#); 4.6% cross slope near drain [PP17](#), [PP18](#); 3.1% cross slope near diving benches [PP19](#), [PP20](#); lift not operable independently (checklist); centerline lift seat at 16" [PP35](#), [PP36](#); lift lacks CFS due to 6.8% slope [PP37](#), [PP38](#); lift only submerges to 12" [PP34](#); stair risers at deck 8" to 14.5" [PP31](#), [PP32](#); lacks second handrail [PP32](#); lacks accessible dining tables [PP25](#), [PP29](#)

***Recommendations (Peoria Pool is a site designated as accessible so 1.16.1 through 1.16.8 is integral to compliance with title II program access test):***

- 1.16.1 **Remove obstacles** from pool deck to prevent CILs (PP21, PP22, PP12)
- 1.16.2 **Repair, fill, and maintain** gaps on pool deck to max .5" (PP23, PP24)
- 1.16.3 **Correct or repair** slopes along the pool deck to 2.08% max cross and 5% max running (PP17, PP18, PP19, PP20)
- 1.16.4 **Replace** lift with a model that is operable independently and install at all times that the pool is open (PP35, PP36, PP34, checklist)
- 1.16.5 **Correct or repair slope** at lift to max 2.08% to allow CFS (PP37, PP38)
- 1.16.6 **Correct or repair riser heights on** pool stairs to be consistent; leave as is if technically infeasible (PP31, PP32)
- 1.16.7 **Install** another handrail at pool stairs, 20" to 24" from existing handrail (PP32)
- 1.16.8 **Replace 5% of dining tables** with ones with knee and toe clearance (PP25, PP29)

Responsible Employee	Progress Towards Completion	Recommended Phase
Brenda Rehnke Recreation Manager 623-773-7131	(insert periodic notes regarding steps taken or work completed)	PHASE THREE